

# Air Monitoring Summary Tables

The table below summarizes monitoring data collected using the H<sub>2</sub>S analyzers deployed at the onsite stations. All times in Eastern Standard Time (EST).

**From: 05/07/26 12:00 am**

**To: 05/07/26 11:59 pm**

## Onsite Fenceline Monitors

Instrument	Analyte	30-min AEGL Reached?	Concentration Range Detected <sup>a</sup>	24-hr Average <sup>a</sup>	7-day Average	30-min AEGL
<b>Station 1</b>						
TAPI Analyzer	H <sub>2</sub> S	No	1 – 27 ppb	5.43 ppb <sup>b</sup>	3.24 ppb	600 ppb
<b>Station 2</b>						
TAPI Analyzer	H <sub>2</sub> S	No	0 – 25 ppb	1.58 ppb <sup>c</sup>	0.87 ppb	600 ppb
<b>Station 3</b>						
TAPI Analyzer	H <sub>2</sub> S	No	0 – 15 ppb	2.90 ppb <sup>d</sup>	1.35 ppb	600 ppb

<sup>a</sup> Based on 30-minute averages.

<sup>b</sup> The 24-hour H<sub>2</sub>S average at Station 1 is not represented by the full 24-hour sampling period; a total of 4 30-minute averages are missing due to a quarterly audit conducted at this location.


<sup>c</sup> The 24-hour H<sub>2</sub>S average at Station 2 is not represented by the full 24-hour sampling period; a total of 4 30-minute averages are missing due to a quarterly audit conducted at this location.

<sup>d</sup> The 24-hour H<sub>2</sub>S average at Station 3 is represented by the back-up unit for the entire reporting period. The 24-hour H<sub>2</sub>S average at Station 3 is not represented by the full 24-hour sampling period; a total of 26 30-minute averages are missing due to a power outage at this location.

### Notes:



ATSDR MRL      Agency for Toxic Substances and Disease Registry Minimal Risk Level (MRL)  
 AEGL            EPA Acute Exposure Guidelines Levels  
 H<sub>2</sub>S              Hydrogen Sulfide  
 TAPI             Teledyne API H<sub>2</sub>S Analyzer  
 hr                Hour  
 min              Minute  
 ppb              Parts per billion  
 MRL Limit      Limit defined as a 14-day average value

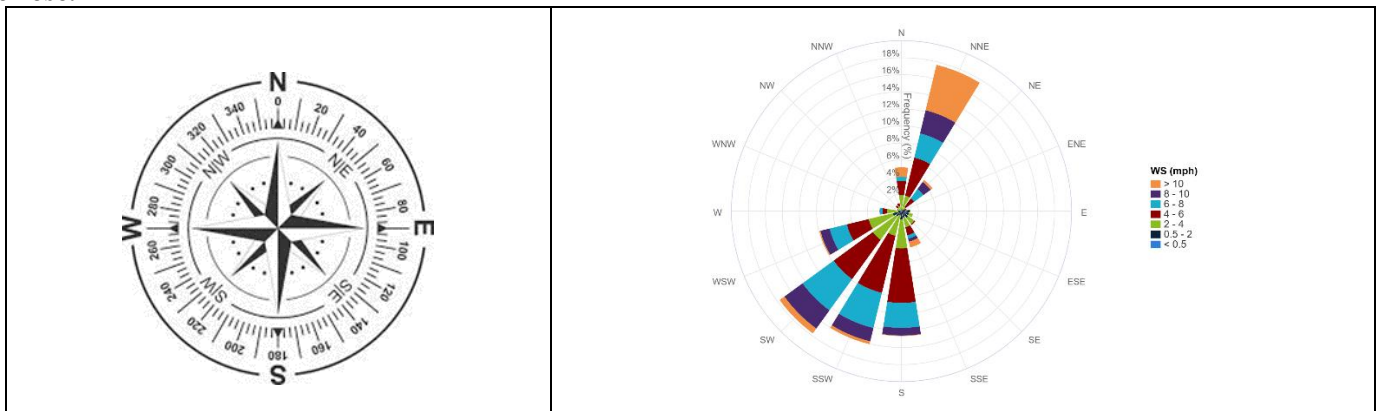**Station 1 Wind Rose – Shows the direction the wind is coming from, the monitoring station being at the center of the rose.**





**Legend**

-  Onsite Fixed Monitoring Locations
-  New-Indy Catawba



## Period H<sub>2</sub>S Monitoring Hydrogen Sulfide Onsite Monitors

Below are graphs for onsite locations during the current reporting period.


Depending on wind direction, the H<sub>2</sub>S measured at the onsite fence line locations may not exit the mill property at reported concentrations. Wind directions from offsite locations, blowing onto mill property, will disperse ambient concentrations to lower levels prior to exiting the plant site.

Winds were coming from a variable direction throughout the day at 1 to 16 mph.

See wind rose diagram with an aerial map figure for full wind data during this reporting period.

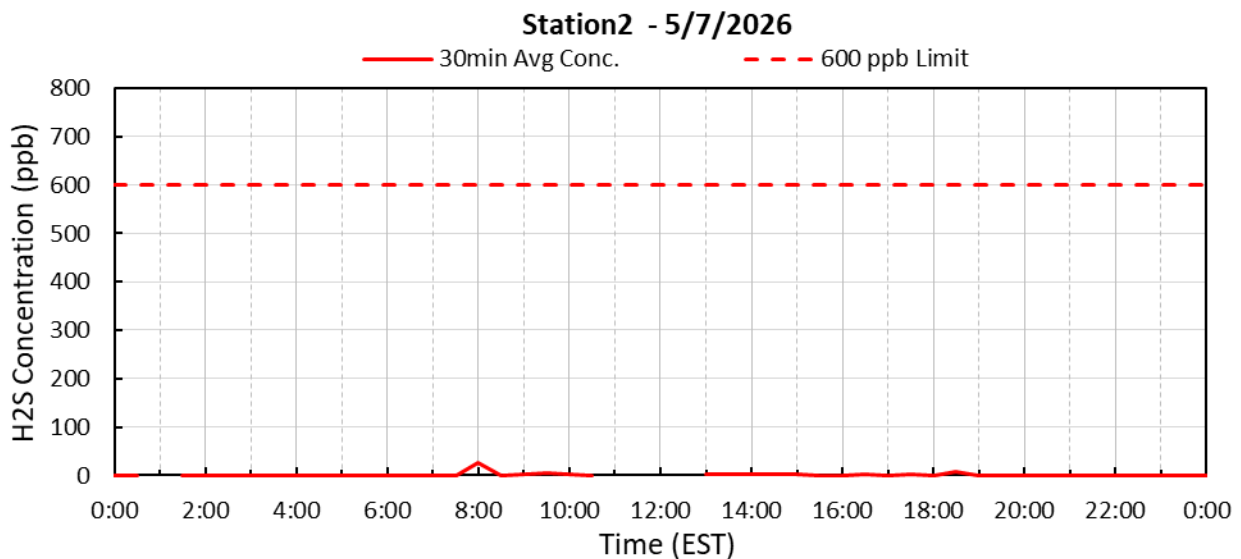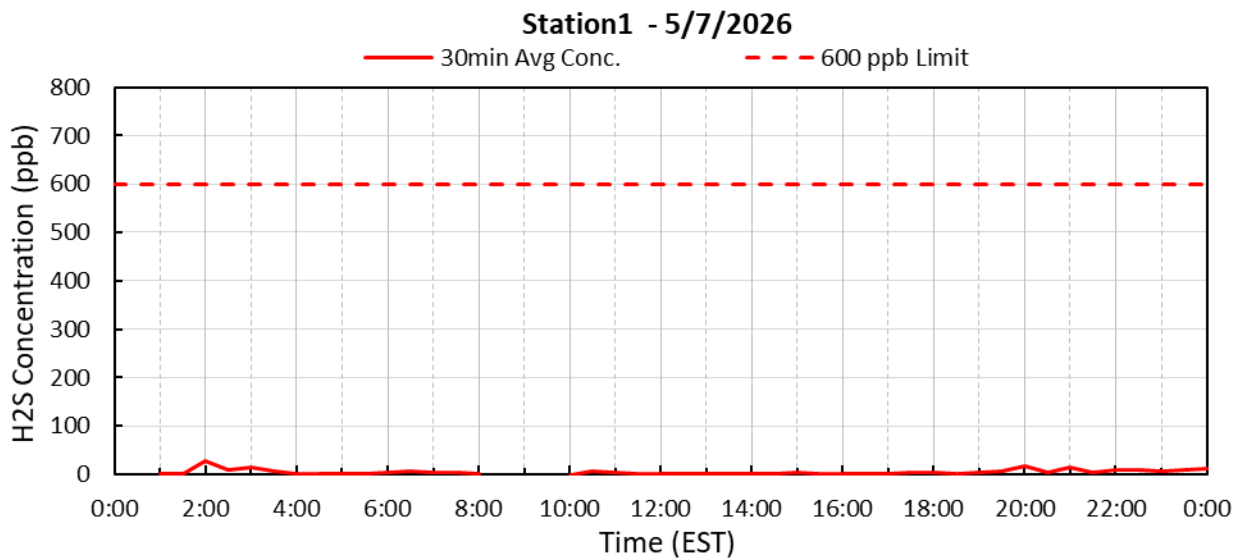

### Station3 - 5/7/2026

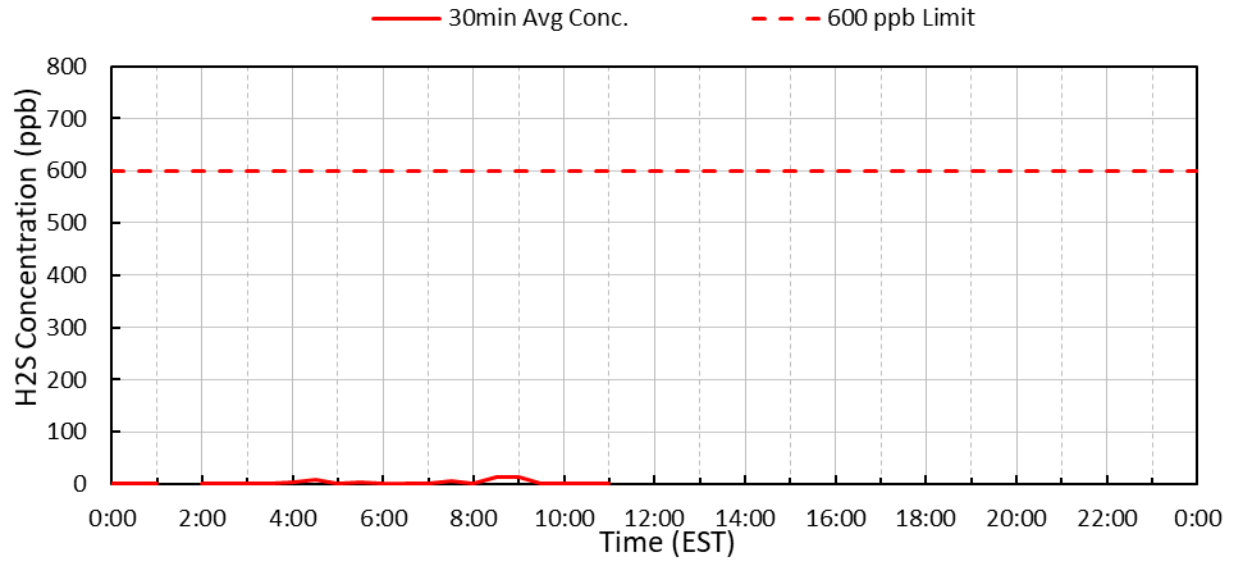

Submitted Fenceline H<sub>2</sub>S and Met 30-minute Data

30-Minute Avgs	Station 1			Station 2			Station 3		
	Station 1	Met		H2S	Met		H2S	Met	
5/7/2026	30min Avg H2S Conc.	30min Avg WS	30min Avg WD	30min Avg H2S Conc.	30min Avg WS	30min Avg WD	30min Avg H2S Conc.	30min Avg WS	30min Avg WD
Date / Time	ppb	mph	degrees	ppb	mph	degrees	ppb	mph	degrees
5/7/2026 0:30	AX	2.2	150	0.2	0.6	152	0.2	0.7	89
5/7/2026 1:00	1.5	1.2	90	AX	0.5	6	0.2	0.3	55
5/7/2026 1:30	1.7	1.9	275	0.2	1.1	347	AX	0.9	36
5/7/2026 2:00	27.3	3.0	10	0.2	1.7	2	0.4	0.8	61
5/7/2026 2:30	10.2	5.7	42	0.2	0.5	28	0.2	0.9	29
5/7/2026 3:00	14.9	6.1	23	0.2	3.2	6	0.2	2.4	69
5/7/2026 3:30	6.3	8.9	169	0.2	2.5	189	0.6	2.6	38
5/7/2026 4:00	2.6	6.6	202	0.7	2.4	214	3.5	2.2	54
5/7/2026 4:30	1.6	4.7	186	0.6	2.3	200	9.1	2.2	37
5/7/2026 5:00	1.5	4.8	178	0.7	2.2	191	0.8	1.7	49
5/7/2026 5:30	2.6	4.6	206	0.5	1.7	206	4.7	2.1	53
5/7/2026 6:00	5.3	5.6	186	0.2	2.5	202	2.2	2.5	37
5/7/2026 6:30	6.5	5.4	182	0.2	2.4	197	0.4	1.6	41
5/7/2026 7:00	3.9	6.7	190	0.2	3.3	199	0.2	3.0	40
5/7/2026 7:30	2.9	7.4	203	0.2	3.8	213	5.0	3.2	45
5/7/2026 8:00	2.3	6.0	232	25.1	4.0	236	2.2	2.5	54
5/7/2026 8:30	BL	4.4	200	0.9	2.7	201	14.1	2.0	39
5/7/2026 9:00	BL	3.6	221	2.1	2.3	219	14.5	1.0	60
5/7/2026 9:30	BL	2.8	237	4.0	2.1	295	0.2	0.8	72
5/7/2026 10:00	BL	2.6	195	1.9	1.3	221	0.4	1.3	61
5/7/2026 10:30	5.8	1.7	171	0.2	0.9	187	1.1	1.2	94
5/7/2026 11:00	5.4	4.0	197	BL	2.7	206	0.6	2.1	195
5/7/2026 11:30	1.5	5.7	229	BL	3.2	226	AV	AV	AV
5/7/2026 12:00	1.6	3.8	246	BL	3.0	281	AV	AV	AV
5/7/2026 12:30	1.7	5.0	229	BL	4.1	239	AV	AV	AV
5/7/2026 13:00	2.7	3.7	220	1.7	BL	BL	AV	AV	AV
5/7/2026 13:30	2.2	3.5	231	2.6	3.3	245	AV	AV	AV
5/7/2026 14:00	2.6	5.0	224	3.7	4.0	251	AV	AV	AV
5/7/2026 14:30	1.9	7.0	225	3.3	3.9	242	AV	AV	AV
5/7/2026 15:00	2.8	5.9	219	2.3	3.8	222	AV	AV	AV
5/7/2026 15:30	1.4	7.1	222	0.2	3.8	221	AV	AV	AV
5/7/2026 16:00	2.1	7.1	211	0.2	4.0	217	AV	AV	AV
5/7/2026 16:30	2.0	7.9	222	2.3	4.7	231	AV	AV	AV
5/7/2026 17:00	2.6	5.6	218	1.1	3.8	224	AV	AV	AV
5/7/2026 17:30	3.4	6.3	203	2.8	3.7	222	AV	AV	AV
5/7/2026 18:00	3.3	5.9	210	0.4	2.4	208	AV	AV	AV
5/7/2026 18:30	1.5	7.0	233	6.6	4.5	246	AV	AV	AV
5/7/2026 19:00	4.5	15.6	11	0.2	6.4	359	AV	AV	AV
5/7/2026 19:30	7.5	14.5	18	0.2	2.3	16	AV	AV	AV
5/7/2026 20:00	17.7	13.0	26	0.2	2.2	32	AV	AV	AV
5/7/2026 20:30	3.4	9.3	32	0.2	1.1	43	AV	AV	AV
5/7/2026 21:00	14.4	8.7	22	0.2	1.6	13	AV	AV	AV
5/7/2026 21:30	4.3	7.6	33	0.2	0.6	73	AV	AV	AV
5/7/2026 22:00	8.4	7.0	26	0.2	0.5	28	AV	AV	AV
5/7/2026 22:30	9.2	5.2	13	0.2	0.4	33	AV	AV	AV
5/7/2026 23:00	8.0	4.0	15	0.2	0.2	13	AV	AV	AV
5/7/2026 23:30	8.8	3.9	11	0.2	0.4	234	AV	AV	AV
5/8/2026 0:00	11.6	3.4	17	0.2	0.2	168	AV	AV	AV

AQS Null Data Codes	
Qualifier Code	Item Description
AB	TECHNICIAN UNAVAILABLE
AC	CONSTRUCTION/REPAIRS IN AREA
AD	SHELTER STORM DAMAGE
AE	SHELTER TEMPERATURE OUTSIDE LIMITS
AI	INSUFFICIENT DATA (CAN'T CALCULATE)
AM	MISCELLANEOUS VOID
AN	MACHINE MALFUNCTION
AO	BAD WEATHER
AP	VANDALISM
AS	POOR QUALITY ASSURANCE RESULTS
AT	CALIBRATION
AU	MONITORING WAIVED
AV	POWER FAILURE (POWR)
AW	WILDLIFE DAMAGE
AX	PRECISION CHECK (PREC)
AY	QC CONTROL POINTS (ZERO/SPAN)
BA	MAINTENANCE/ROUTINE REPAIRS
BB	UNABLE TO REACH SITE
BC	MULTI-POINT CALIBRATION
BD	AUTO CALIBRATION
BE	BUILDING/SITE REPAIR
BF	PRECISION/ZERO/SPAN
BJ	OPERATOR ERROR
BK	SITE COMPUTER/DATA LOGGER DOWN
BL	QC AUDIT (AUDT)
EC	EXCEED CRITICAL CRITERIA