

Air Monitoring Summary Tables

The table below summarizes monitoring data collected using a portable wireless remote monitoring system.

All times in Eastern Standard Time (EST).

From: 4/1/22 12:00 am

To: 4/1/22

11:59 pm

Offsite Monitors

| Instrument | Analyte | ATSDR MRL 14-day Avg Reached? | Concentration Range Detected ^a | 24-hr Average ^a | 7-day Average | ATSDR 14-day MRL |
|---------------------------|------------------|-------------------------------------|--|----------------------------|------------------|---------------------|
| Catawba Headstart | | | | | | |
| Acrulog PPB | H ₂ S | No | 0 – 0 ppb | 0.00 ppb | 0.00 ppb | 70 ppb |
| Treetops | | | | | | |
| Acrulog PPB | H ₂ S | No | 0 – 6 ppb | 0.48 ppb ^b | 0.07 ppb | 70 ppb |
| Liberty Hill | | | | | | |
| Acrulog PPB | H ₂ S | No | 0 – 0 ppb | 0.00 ppb ^c | 0.00 ppb | 70 ppb |
| Riverchase Estates | | | | | | |
| Acrulog PPB | H ₂ S | No | 0 – 3 ppb | 0.15 ppb ^d | 0.02 ppb | 70 ppb |
| Millstone Creek | | | | | | |
| Acrulog PPB | H ₂ S | No | 0 – 4 ppb | 0.34 ppb | 0.07 ppb | 70 ppb |

^b Routine precision check at Treetops at 11:00 EST. The 24-hr average at this location is not represented by the full 24-hr period; a total of 1 30-minute averages are missing from the reported period.

^c Routine precision check at Liberty Hill at 14:00 EST. The 24-hr average at this location is not represented by the full 24-hr period; a total of 1 30-minute averages are missing from the reported period.

^d Routine precision check at Riverchase Estates at 16:00 EST. The 24-hr average at this location is not represented by the full 24-hr period; a total of 1 30-minute averages are missing from the reported period.

Onsite Fenceline Monitors



| Instrument | Analyte | 30-min AEGL Reached? | Concentration Range Detected ^a | 24-hr Average ^a | 7-day Average | 30-min AEGL |
|------------------|------------------|-------------------------|--|----------------------------|---------------|-------------|
| Station 1 | | | | | | |
| TAPI Analyzer | H ₂ S | No | 0 – 8 ppb | 0.75 ppb | 0.38 ppb | 600 ppb |
| Station 2 | | | | | | |
| TAPI Analyzer | H ₂ S | No | 0 – 10 ppb | 2.36 ppb | 1.32 ppb | 600 ppb |
| Station 3 | | | | | | |
| TAPI Analyzer | H ₂ S | No | 0 – 2 ppb | 0.59 ppb | 0.94 ppb | 600 ppb |

^a Based on 30-minute averages.




Notes:

| | |
|------------------|---|
| ATSDR MRL | Agency for Toxic Substances and Disease Registry Minimal Risk Level (MRL) |
| AEGL | EPA Acute Exposure Guidelines Levels |
| H ₂ S | Hydrogen Sulfide |
| TAPI | Teledyne API H ₂ S Analyzer |
| hr | Hour |
| min | Minute |
| ppb | Parts per billion |
| MRL Limit | Limit defined as a 14-day average value. |

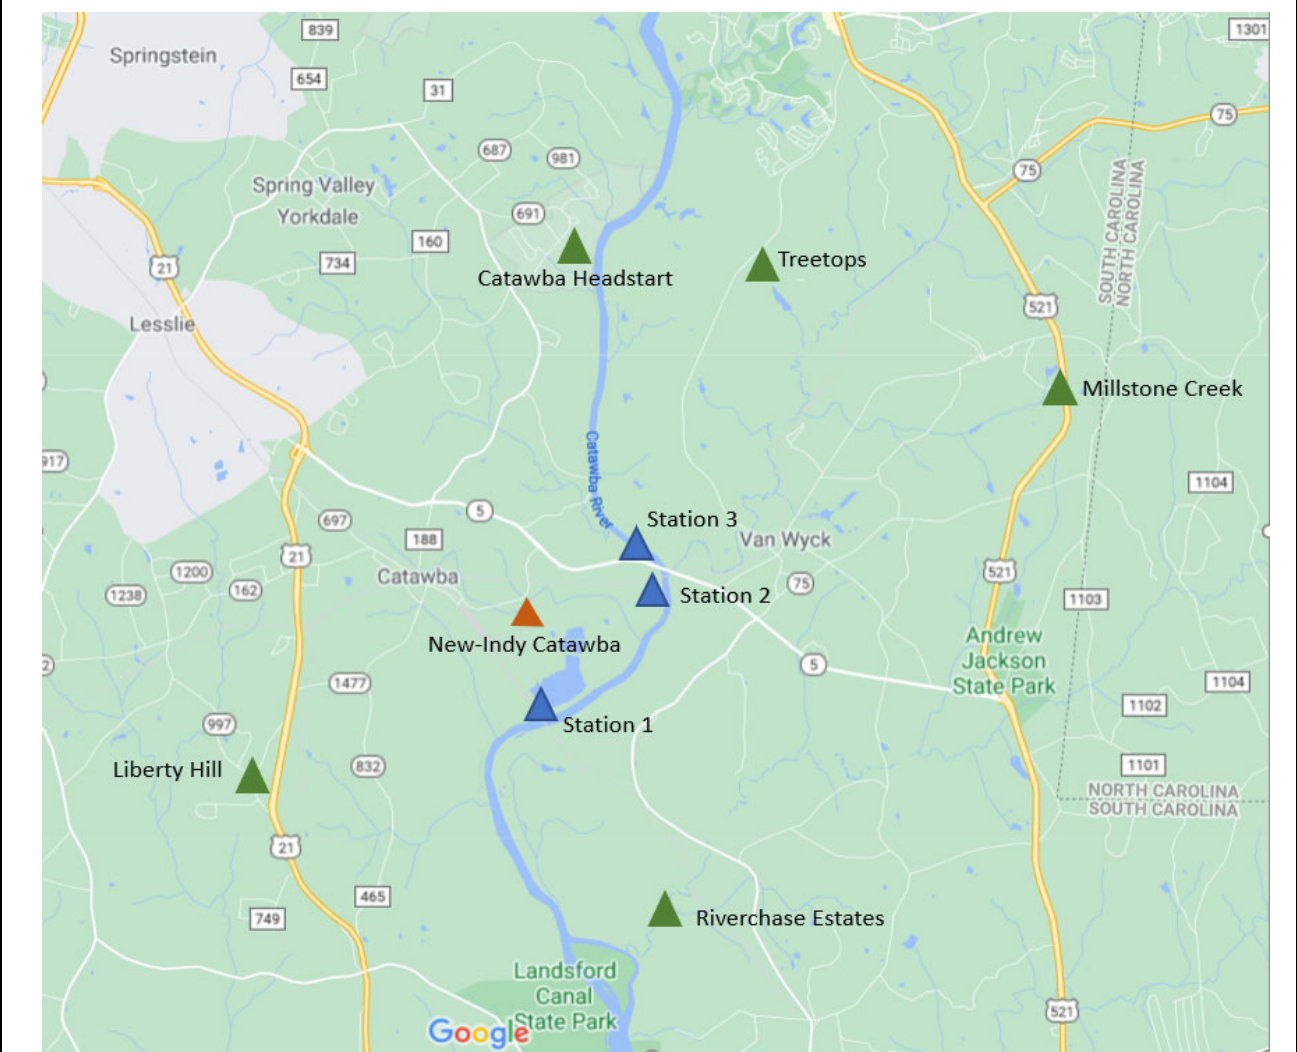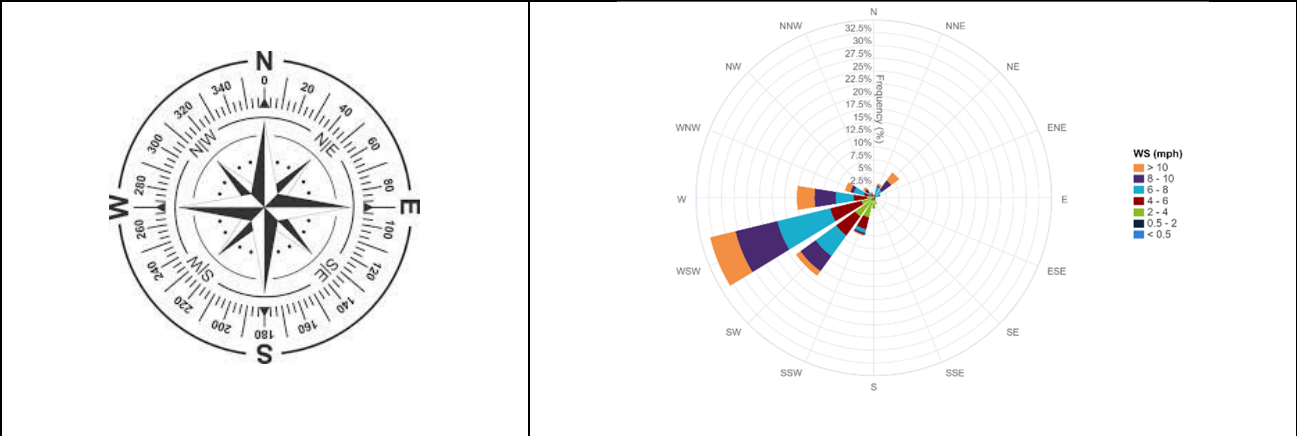Wind rose – Shows the direction the wind is coming from, the monitoring station being at the center of the rose.



Legend

-  Offsite Fixed Monitoring Locations
-  Onsite Fixed Monitoring Locations
-  New-Indy Catawba


Period H₂S Monitoring Hydrogen Sulfide Offsite Monitors

Below are graphs for offsite locations where hydrogen sulfide (H₂S) was detected during the current reporting period.


The five stand-alone H₂S monitoring stations correlate with five previous EPA's Viper monitoring system which includes areas to the north-northeast and south-southwest of the New-Indy Catawba Mill.

Winds came from the west-southwest at 6 to 12 miles per hour.


See wind rose diagram with aerial map figure for full wind data during this reporting period.

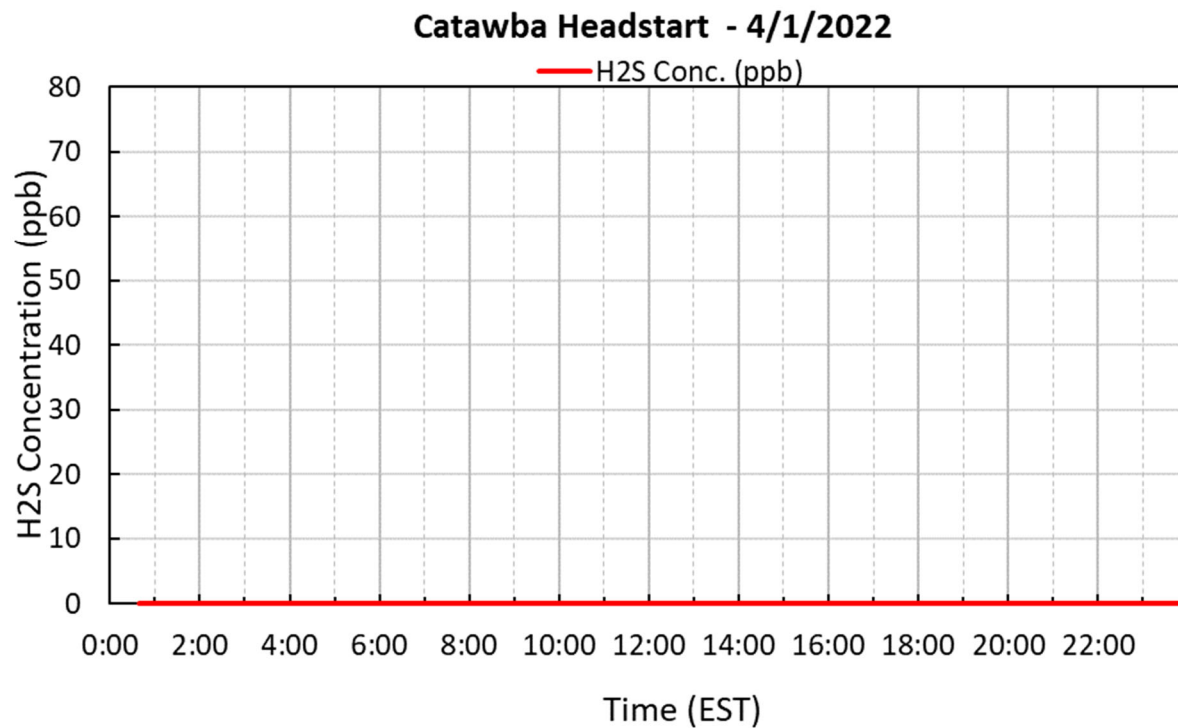


Treetops - 4/1/2022

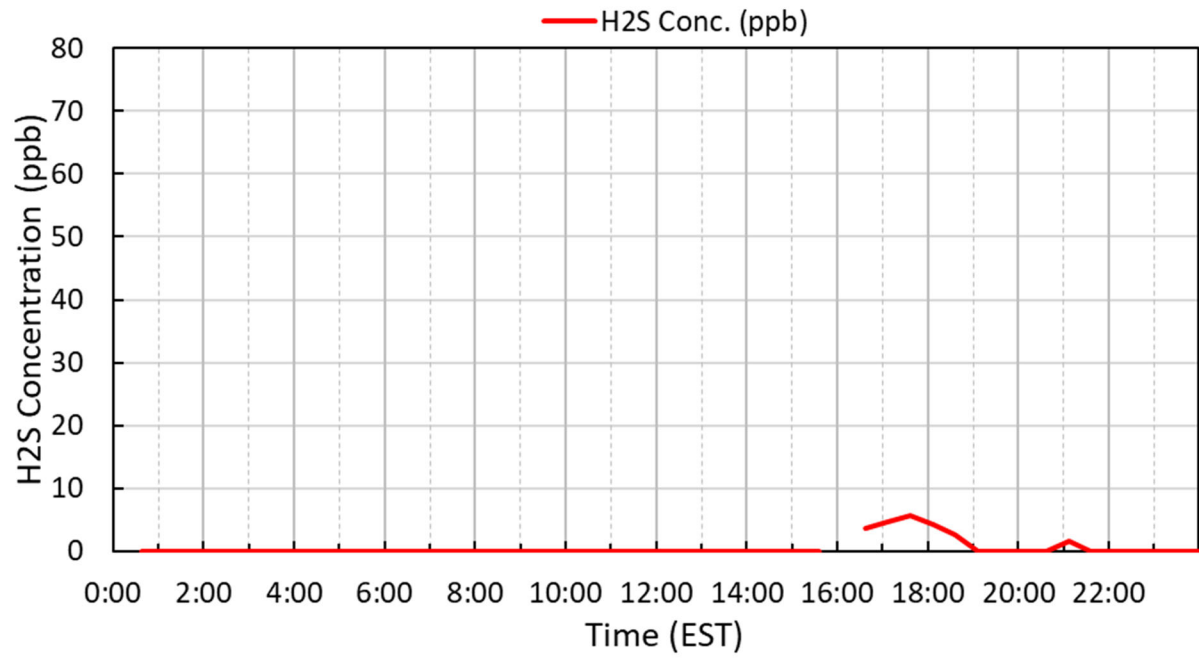


Liberty Hill - 4/1/2022

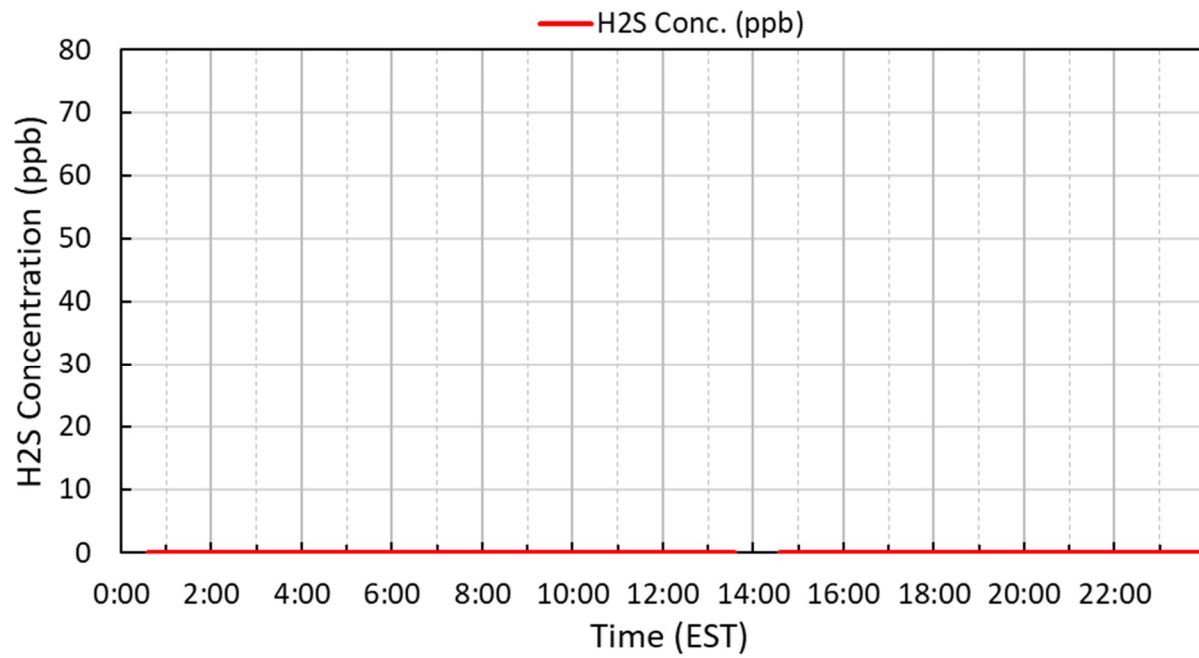

Riverchase Estates - 4/1/2022

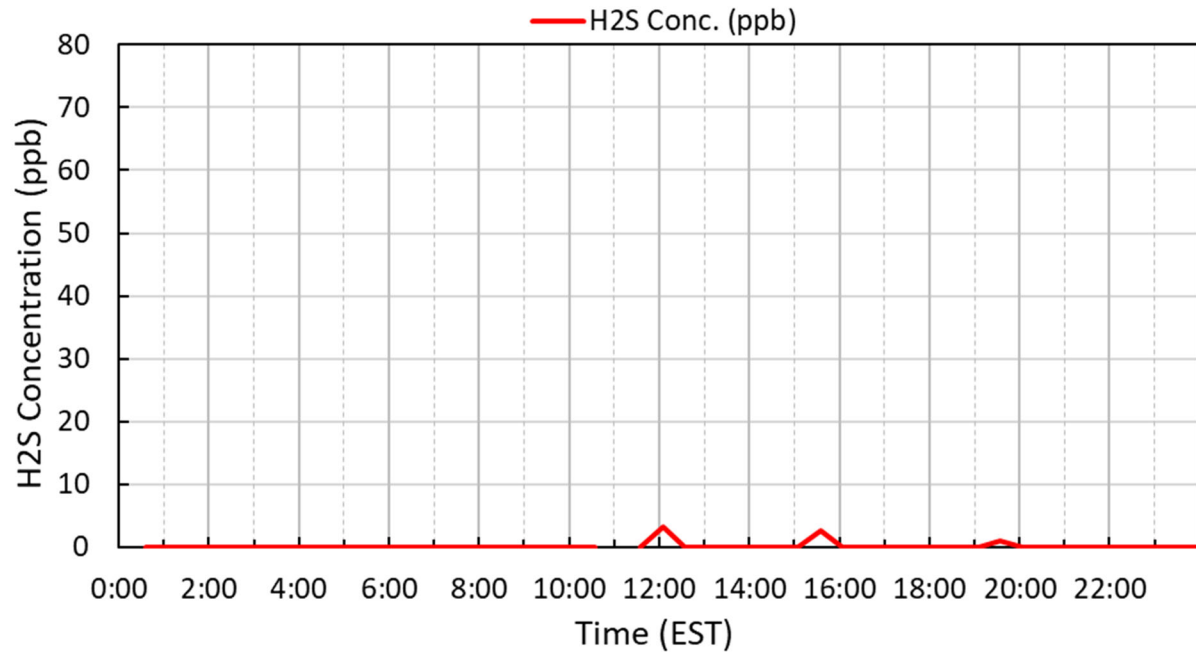

Millstone Creek - 4/1/2022

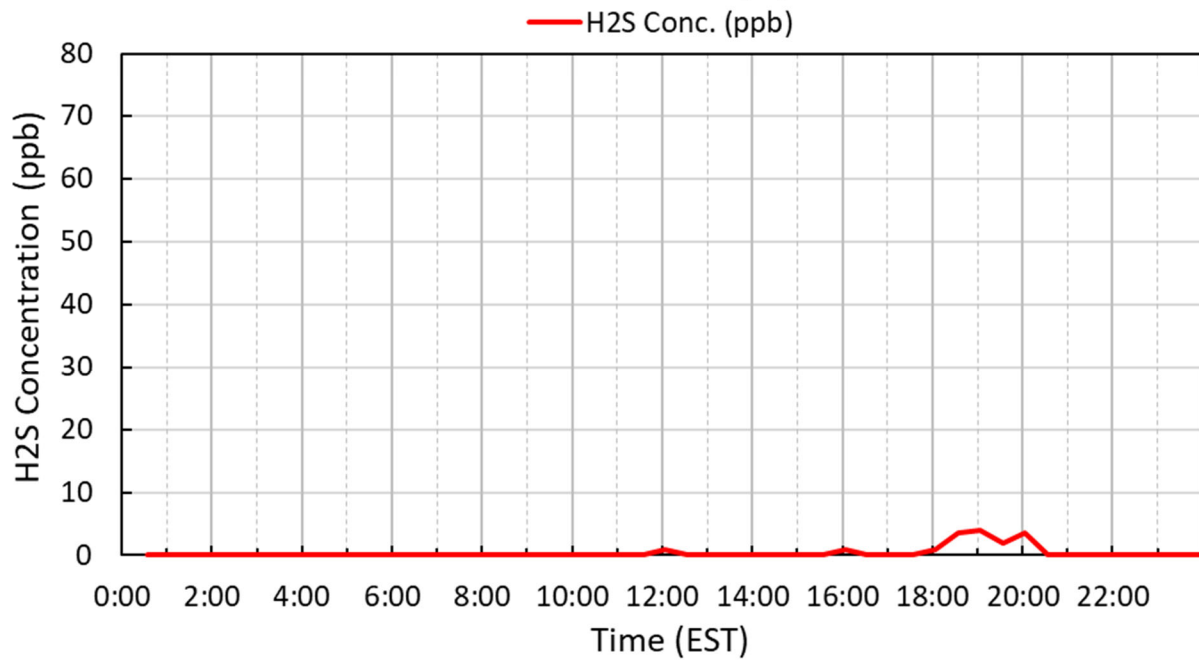



Period H₂S Monitoring Hydrogen Sulfide Onsite Monitors

Below are graphs for onsite locations during the current reporting period.

Depending on wind direction, the H₂S measured at the onsite fence line locations may not exit mill property at reported concentrations. Wind directions from offsite locations, blowing onto mill property, will disperse ambient concentrations to lower levels prior to exiting the plant site.

Winds came from the west-southwest at 6 to 12 miles per hour.

See wind rose diagram with aerial map figure for full wind data during this reporting period.

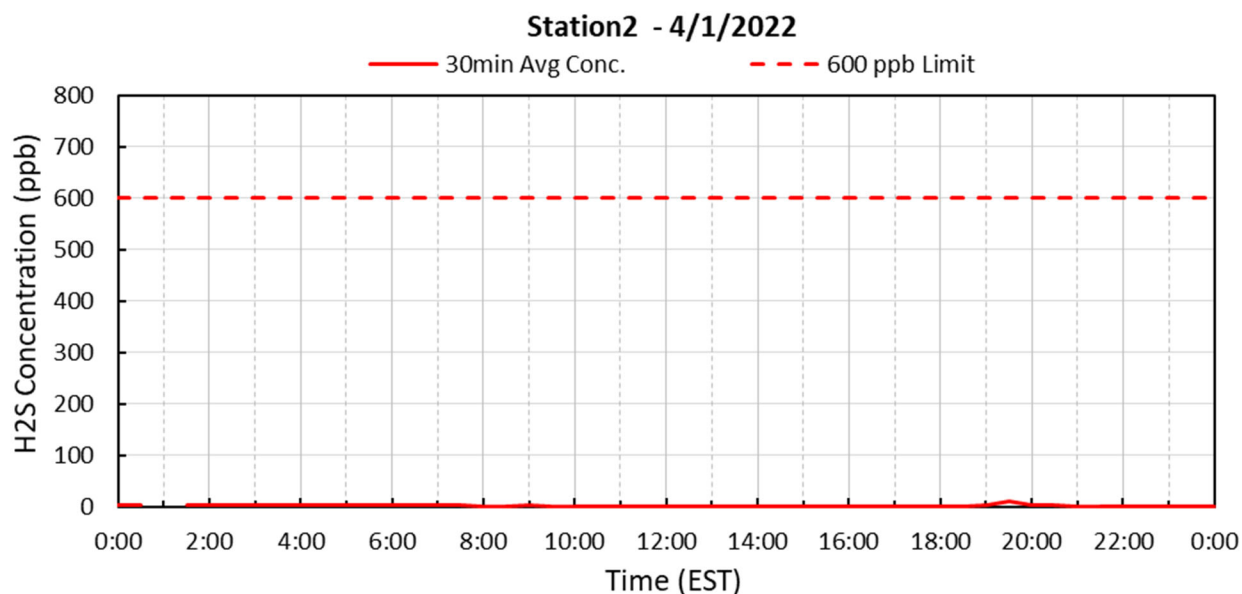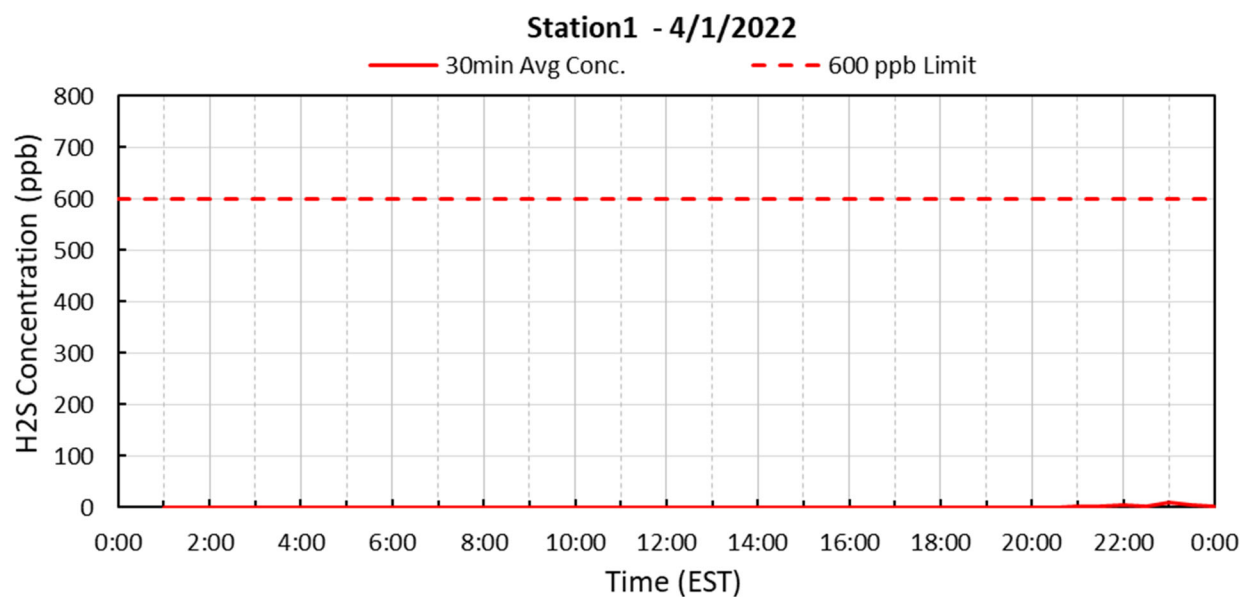

Station3 - 4/1/2022

