

# Air Monitoring Summary Tables

The table below summarizes monitoring data collected using the H<sub>2</sub>S analyzers deployed at the onsite stations. All times in Eastern Standard Time (EST).

**From: 11/17/24 12:00 am**

**To: 11/17/24 11:59 pm**

## Onsite Fenceline Monitors

Instrument	Analyte	30-min AEGL Reached?	Concentration Range Detected <sup>a</sup>	24-hr Average <sup>a</sup>	7-day Average	30-min AEGL
<b>Station 1</b>						
TAPI Analyzer	H <sub>2</sub> S	No	0 – 19 ppb	3.77 ppb <sup>b</sup>	2.16 ppb	600 ppb
<b>Station 2</b>						
TAPI Analyzer	H <sub>2</sub> S	No	0 – 2 ppb	0.40 ppb <sup>c</sup>	0.36 ppb	600 ppb
<b>Station 3</b>						
TAPI Analyzer	H <sub>2</sub> S	No	0 – 4 ppb	0.62 ppb	0.38 ppb	600 ppb

<sup>a</sup> Based on 30-minute averages.


<sup>b</sup> The 24-hour H<sub>2</sub>S average at Station 1 from the start of the sampling period to the end of the sampling period is represented by the backup unit data.

<sup>c</sup> The 24-hour H<sub>2</sub>S average at Station 2 from the start of the sampling period to the end of the sampling period is represented by the backup unit data

### Notes:

ATSDR MRL	Agency for Toxic Substances and Disease Registry Minimal Risk Level (MRL)
AEGL	EPA Acute Exposure Guidelines Levels
H <sub>2</sub> S	Hydrogen Sulfide
TAPI	Teledyne API H <sub>2</sub> S Analyzer
hr	Hour
min	Minute
ppb	Parts per billion
MRL Limit	Limit defined as a 14-day average value

**Station 1 Wind Rose – Shows the direction the wind is coming from, the monitoring station being at the center of the rose.**

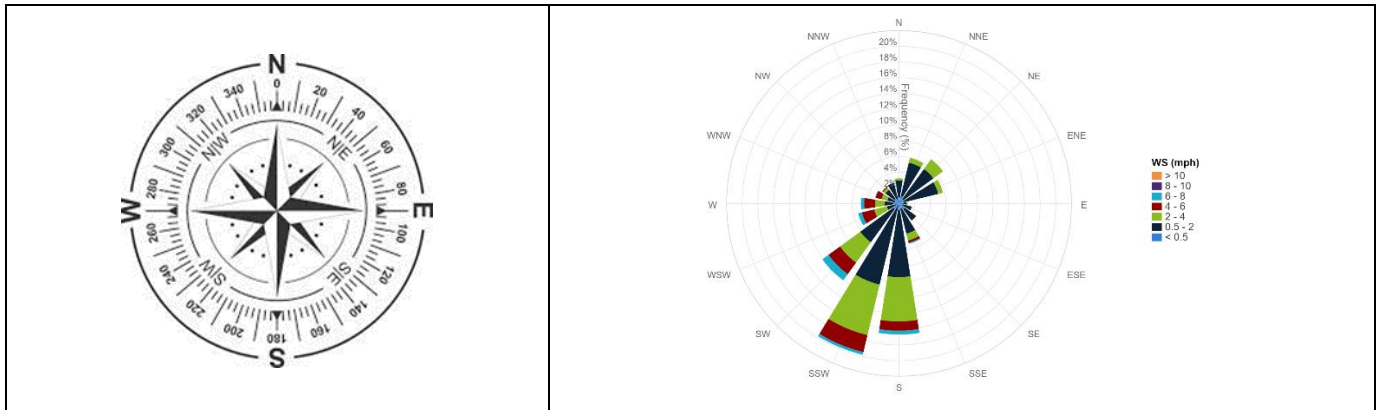



**Legend**

-  Onsite Fixed Monitoring Locations
-  New-Indy Catawba



## Period H<sub>2</sub>S Monitoring Hydrogen Sulfide Onsite Monitors

Below are graphs for onsite locations during the current reporting period.

Depending on wind direction, the H<sub>2</sub>S measured at the onsite fence line locations may not exit the mill property at reported concentrations. Wind directions from offsite locations, blowing onto mill property, will disperse ambient concentrations to lower levels prior to exiting the plant site.


Winds were coming from a variable direction throughout the day at 0 to 5 mph.

See wind rose diagram with aerial map figure for full wind data during this reporting period.

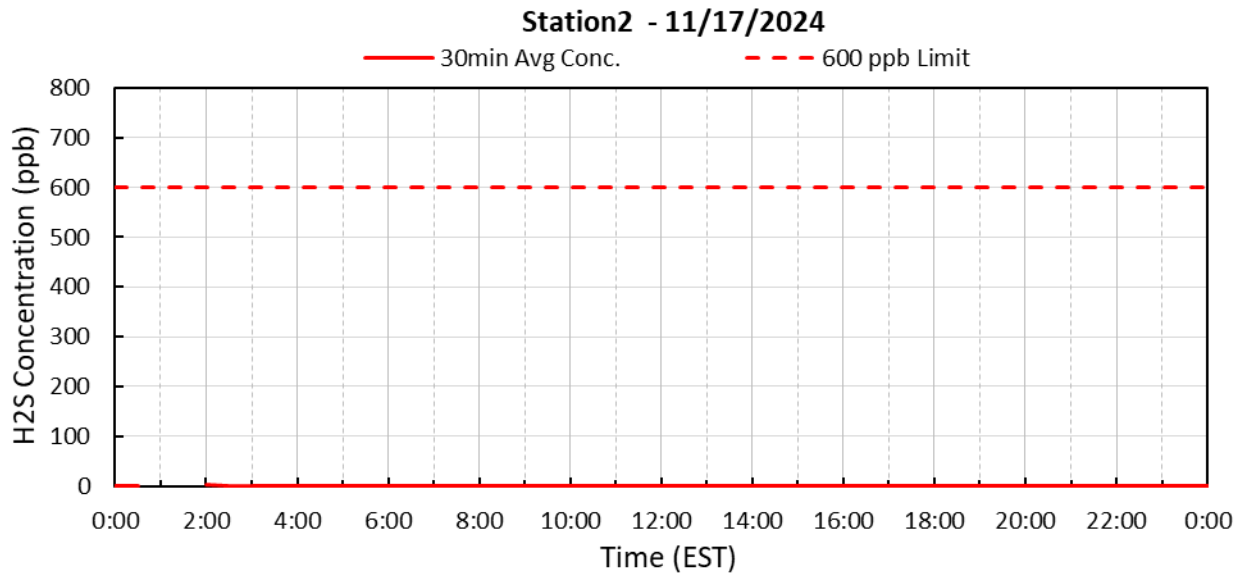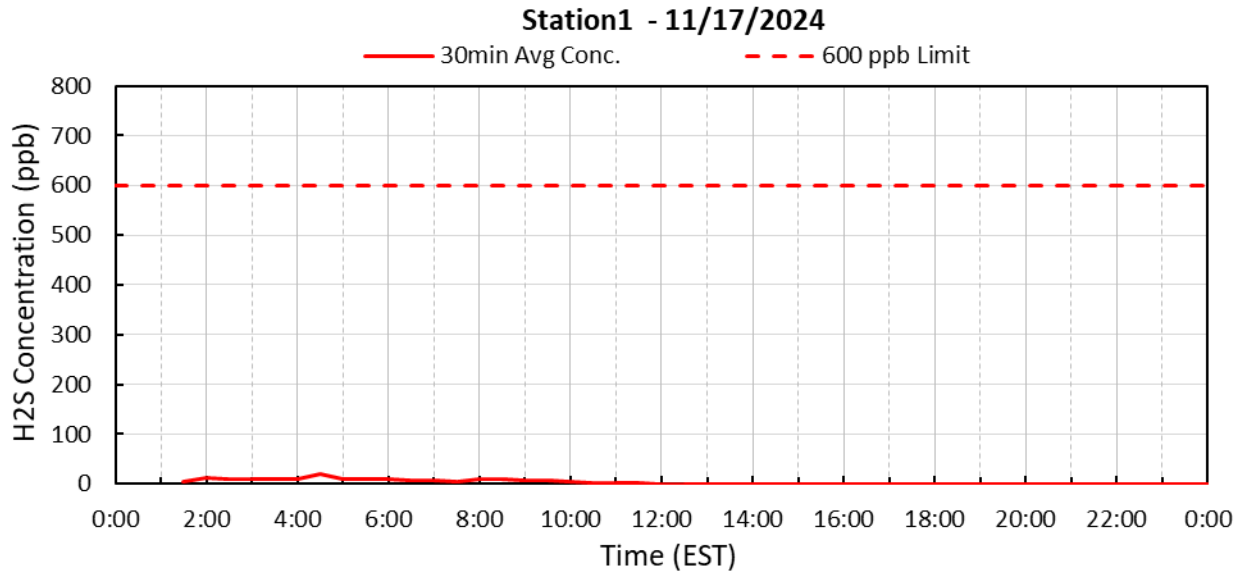

### Station3 - 11/17/2024

— 30min Avg Conc.      - - - 600 ppb Limit

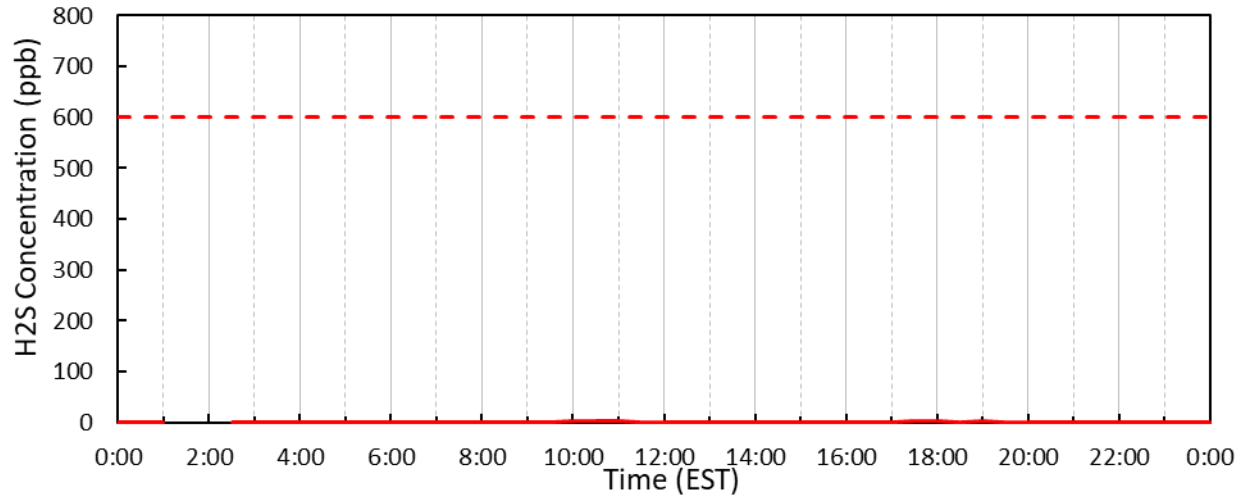

Submitted Fenceline H<sub>2</sub>S and Met 30-minute Data

30-Minute Avgs	Station 1			Station 2			Station 3		
	H2S	Met		H2S	Met		H2S	Met	
	30min Avg H2S Conc.	30min Avg WS	30min Avg WD	30min Avg H2S Conc.	30min Avg WS	30min Avg WD	30min Avg H2S Conc.	30min Avg WS	30min Avg WD
Date / Time	ppb	mph	degrees	ppb	mph	degrees	ppb	mph	degrees
11/17/2024 0:30	BF	0.8	176	0.2	0.7	2	0.2	0.2	338
11/17/2024 1:00	BF	0.6	180	BF	0.7	9	0.2	0.3	5
11/17/2024 1:30	5.8	0.7	136	BF	0.8	13	BF	0.4	15
11/17/2024 2:00	12.1	0.5	280	2.0	0.8	27	BF	0.3	26
11/17/2024 2:30	9.2	0.8	315	0.2	0.8	16	1.4	0.3	6
11/17/2024 3:00	8.9	1.0	49	0.2	0.5	21	0.2	0.4	21
11/17/2024 3:30	9.2	1.2	31	0.2	1.1	358	0.2	0.4	11
11/17/2024 4:00	8.7	1.5	43	0.2	1.1	358	0.2	0.5	4
11/17/2024 4:30	19.0	1.4	359	0.2	0.7	11	0.2	0.2	153
11/17/2024 5:00	10.4	1.1	49	0.2	0.6	360	0.2	0.3	8
11/17/2024 5:30	10.0	1.3	22	0.2	0.8	357	0.2	0.4	30
11/17/2024 6:00	8.8	1.5	17	0.2	0.8	8	0.2	0.3	24
11/17/2024 6:30	7.0	1.9	56	0.2	0.6	3	0.2	0.5	27
11/17/2024 7:00	8.2	2.0	28	0.2	1.0	351	0.2	0.3	35
11/17/2024 7:30	5.9	1.2	20	0.2	1.1	4	0.2	0.2	242
11/17/2024 8:00	8.6	0.7	358	0.2	0.6	12	0.2	0.3	83
11/17/2024 8:30	10.1	0.8	1	0.2	0.7	356	0.2	0.4	12
11/17/2024 9:00	7.8	0.4	324	0.6	0.2	339	0.2	0.3	28
11/17/2024 9:30	7.4	0.5	78	1.4	0.4	124	0.7	0.4	112
11/17/2024 10:00	4.6	2.4	174	1.3	1.2	200	1.7	0.9	157
11/17/2024 10:30	2.6	2.8	180	1.5	2.1	220	4.0	1.2	161
11/17/2024 11:00	1.4	3.5	195	0.5	3.1	211	2.1	1.8	134
11/17/2024 11:30	0.9	4.8	194	0.2	3.5	213	0.8	2.6	198
11/17/2024 12:00	0.6	4.6	235	0.2	4.5	225	0.2	2.2	216
11/17/2024 12:30	0.4	5.2	229	0.2	4.5	232	0.4	1.7	222
11/17/2024 13:00	0.2	3.5	258	0.2	3.9	226	0.2	1.5	252
11/17/2024 13:30	0.2	3.3	210	0.2	3.3	229	0.2	2.0	245
11/17/2024 14:00	0.2	4.3	218	0.2	3.5	228	0.2	2.1	242
11/17/2024 14:30	0.2	4.9	230	0.2	3.7	227	0.4	1.8	216
11/17/2024 15:00	0.2	4.1	243	0.2	4.1	244	0.2	1.5	238
11/17/2024 15:30	0.2	3.3	264	0.5	3.9	245	0.2	1.3	255
11/17/2024 16:00	0.2	2.6	230	0.9	3.4	241	0.2	0.7	264
11/17/2024 16:30	0.2	3.0	191	0.2	2.5	227	0.2	0.6	272
11/17/2024 17:00	0.5	1.9	192	0.2	1.1	200	0.5	0.6	229
11/17/2024 17:30	0.2	1.9	206	1.2	0.4	15	2.2	0.4	217
11/17/2024 18:00	0.2	1.9	204	1.2	0.3	86	1.7	0.4	188
11/17/2024 18:30	0.2	1.9	207	0.4	0.2	77	1.3	0.2	88
11/17/2024 19:00	0.2	1.2	210	0.2	0.3	94	1.6	0.3	200
11/17/2024 19:30	0.2	1.9	212	0.2	0.2	41	1.4	0.3	313
11/17/2024 20:00	0.2	1.5	179	0.2	0.2	69	0.6	0.4	99
11/17/2024 20:30	0.2	1.5	202	0.2	0.2	310	0.4	0.2	153
11/17/2024 21:00	0.2	1.4	209	0.2	0.3	265	0.4	0.3	116
11/17/2024 21:30	0.2	1.8	214	0.2	0.6	236	0.7	0.4	230
11/17/2024 22:00	0.4	1.7	185	0.2	0.2	59	0.6	0.2	350
11/17/2024 22:30	0.5	1.3	161	0.2	0.4	40	0.2	0.2	72
11/17/2024 23:00	0.2	0.9	159	0.2	0.2	31	0.2	0.3	96
11/17/2024 23:30	0.2	1.3	181	0.2	0.4	7	0.2	0.2	91
11/18/2024 0:00	0.4	1.5	197	0.2	0.5	4	0.2	0.4	9

AQS Null Data Codes	
Qualifier Code	Item Description
AB	TECHNICIAN UNAVAILABLE
AC	CONSTRUCTION/REPAIRS IN AREA
AD	SHELTER STORM DAMAGE
AE	SHELTER TEMPERATURE OUTSIDE LIMITS
AI	INSUFFICIENT DATA (CAN'T CALCULATE)
AM	MISCELLANEOUS VOID
AN	MACHINE MALFUNCTION
AO	BAD WEATHER
AP	VANDALISM
AS	POOR QUALITY ASSURANCE RESULTS
AT	CALIBRATION
AU	MONITORING WAIVED
AV	POWER FAILURE (POWR)
AW	WILDLIFE DAMAGE
AX	PRECISION CHECK (PREC)
AY	Q C CONTROL POINTS (ZERO/SPAN)
BA	MAINTENANCE/ROUTINE REPAIRS
BB	UNABLE TO REACH SITE
BC	MULTI-POINT CALIBRATION
BD	AUTO CALIBRATION
BE	BUILDING/SITE REPAIR
BF	PRECISION/ZERO/SPAN
BJ	OPERATOR ERROR
BK	SITE COMPUTER/DATA LOGGER DOWN
BL	Q C AUDIT (AUDT)
EC	EXCEED CRITICAL CRITERIA